## <u>CONTACT</u>

## Vintage Glider Club

## BG-135 (Gypsy), YS55 (Consort), SD3-15T

## BG-135 (Gypsy) & YS 55 (Consort) Data Sheet

Status	Subject	Detail	Reference Information	TNS
Μ	Aileron root drive	Suspect riveting	SDL/135/Mod 2	
Μ	Spar at wing root	Missing rivets		
Μ	Aileron push rod	Fouls fairlead	SDL/135/2/74	
Μ	Tailplane final drive	Nuts fouling		
Μ	Release knob failure	No threaded insert		10/74
Μ	Flying controls bolts too short	Stiffnuts not in safely		03/75
Μ	Tailplane spigots	Secure with 'Loctite'		<u>10/75</u>
Μ	U/C attachments	Rivets missing in tube		<u>10/75</u>
Μ	Air brake mechanism jamming	In fuselage near wing root - inadequate clearance		<u>04/76</u>
	Aileron t/e bonded joint	Bond failure		<u>09/77</u>
	Rudder cable stops slippage	Allowing rudder to jam on fin shroud		<u>07/78</u>
	Fuselage to wing lugs worn oval	Repair by fitting bushes		<u>10/79</u>
	Spar rear web	Cracks near the wing root		<u>12/88</u>
Μ	Air brake hinge brackets	Screws not in safely		<u>08/90</u>