

Blanik Aircraft (Czech Republic)

CONTACT

[Blanik Aircraft](#) CZ s.r.o. Beranových 65, Letňany, 199 00, Prague 9, Czech Republic

Airworthiness Directives

Service bulletins made mandatory by the [Czech CAA](#) and [EASA](#)

Blanik L-13 and Vivat Motor Glider

[Blanik L-13 Data Sheet](#)

[Blanik \(Super\) L-23 Data Sheet](#)

Status	Subject	Detail	Reference Information	TNS
R	Instruments	Inspection of LUN1211.1 T/B indicator No 61>	SB L13/010	
R	Controls	Inspection of rudder pedals	SB L13/019	
R	Canopy hinges	Modification to prevent cable hang up on hinges	SB L13/021	
R	Wing	Modification to wing spar web	SB L13/023	
R	Controls	Inspection & replacement of control rods	SB L13/025	
	Rudder cable	Failures at under-floor pulleys tension cables correctly	SB L13/030	10/75
M	Top rudder hinge	Bracket on fin failures rudder detaches	SB L13/034 & L13/40	06/75 & 10/75
R	Technical Manual	Alterations	SB 13/042	
M	Air brake torque tube	Cracked at wing root reinforce	Mod SK-L13.208	03/75
	Life extension	To 25 000 launches & 5 225 hrs after spar inspections	SB L13/045, LET/8/4512/78	04/84
R	Technical Manual	Alterations	SB L13/046	
M	Cable release	Lever mount on bulkhead No 1, reinforce	SB L13/047	03/78
M	Wing root spar	Spacer cracked inspections required	SB L13/048 & L13/053	12/81
M	Outer elevator hinges on TP	Cracked inspect and repair as necessary	SB L13/052	01/79
M	Reinforce wings		SB L13/055	07/82
R	Flight manual	Amendment	SB L13/056	
R	Instructions	For pilots and Flight manual amendment	SB L13/058	
R	Service life	Data unification of overhaul life	SB L13/059	
	Tow release	Layshaft brackets in nose cracked, inspect	FAA AD 78-23-14	10/84
	Overhaul periods	Manufacturers recommended	SB L13/061	06/86
M	Wing root spar strap	Cracked, inspections required	SB L13/062	04/93
M	Elevator drive	Incorrect rigging colour code	AD-4-099/98, SB L13/082a	02/76 , 12/83 & 04/99
M	TBO Extension	Correction to SB L13/085 Inspection B, C, D & TBO extended	AD-T-112/1999R1, SB L13/085a SB L13/092b	02/00 & 04/00 06/00
M	Fuselage	Bulkhead 13 cracking	BGA 012/03/2001 issue1	04/01
I	Type certificate	Change in Type certificate owner	IB L13/094b	12/01