



BGA Airworthiness Compendium
Compendium of Airworthiness Directives, Mandatory Modifications, Special Inspections and Checklist of Defects
Engines

BOMBARDIER-ROTAX SERIES ENGINES

UK Supplier: [CFS Aeroproducts Ltd](#)

[Service Information](#)

[Technical Documentation](#)

Rotax General

Note: Rotax Service Bulletins not supported by AD have been removed from list. For applicable service bulletins refer to Rotax literature and web site

Status	Subject	Detail	Reference Information	TNS
I	Engine TBO	Generic Requirement 24 amended to include Rotax engines		1-2013
M	Maintenance Schedule	New On Condition for all Rotax 2 stroke engines models 275, 501, 505, 535.	SB 505-010, SB 535-009	5-2006

Rotax All - In Service Reports (Advisory)

Status	Subject	Detail	Reference Information	TNS
I	Air supply	Pulse air supply tube restricted		06/01
I	Ignition	BOSCH spark plug cap shorting internally (broken)		06/01
I	2 Stroke engines	If left to dry out oil can thicken and turn to "varnish"		08/01
R	Lubrication	BGA recommendation to change oil @ 25hrs if using Leaded Avgas SI 18-1997 R4		04/04
I	Charging system information	Checking 866 080 regulators		06/03
I	Unleaded fuel	Use of unleaded fuel is permitted if specified in CAA approved flight manual AW Notice 98c		04/04
I	Engine problems	Very expensive engine contamination when using Avgas		04/04
I	Starting problems	If cranking engine is a problem, do not persevere seek advice as engine damage can result		06/05



BGA Airworthiness Compendium
Compendium of Airworthiness Directives, Mandatory Modifications, Special Inspections and Checklist of Defects
Engines

Rotax 912 series

Status	Subject	Detail	Reference Information	TNS
M	912A, 912A. Engine	Rework to ensure proper contact between attachment screws and stator	AD75, TB912-02	
M	912A, F. Propeller gearbox	Inspection and exchange of gearbox	AD 101 SB912-027R1,	04/00
M	912A,F Starter	Engine starter inspection	AD 98 912-026R3	06/00
M	912A. Ignition	Production problems in ignition unit	AD80, TB912-06	
M	912A. Ignition	Ignition problems in areas of heavy radio Transmission	AD82, TB912-07	
M	912A. Carburettors	Possible contamination of carburettors	AD83, TB912-09	
M	912A. Electronic module	Problems with SMD Electronic module in areas of heavy radio transmissions	AD84, TB912-08	
M	912 A3. Gearbox	Exchange of propeller gearbox	AD89, TB912-19	
M	912A & 912UL. Camshaft	Inspection of camshaft	AD92/1, TB912-18	04/97
M	912A & 912F. Fuel pump	Exchange fuel pump and steel fuel line	AD94/1, TB912-20	04/98
M	912A, 912F. Stator	Inspection of engine Stator assay.	AD98, SB912-026R3	06/00
M	912A,F,S. Valves	Replacement of valve spring retainers	AD108, SB912-022	06/01
M	912 Fuel pump	Inspection/replacement	AD109, SB912-031	12/01
		AD Cancelled by EASA	AD113R1, SI-912-010R1	3-2009
M	912 A/F/S Engine mount	Inspection	AD105R1, SB912-028R1	02/03
M	912 A/F/S Crankcase	Inspection	AD107R3, SB912-029R1	04/03
M	912 A, F, S Oil system	New oil dip stick	AD 116, SB912-040 R1	10/03
M	912 A, F, S Coolant	Introduction of new coolant	AD-A-2004-004R2, SB-912-043	2-2006
M	912 A, F, S Oil system	Inspection of magnetic plug within 5 hours and at oil change	AD 2006-0316-R1, SB 912-051	2-2008
M	912 series Inspections	Crank case inspections	AD 2007-0025, SB912-029R3	1-2007
M	912 series Fuel pump	Replacement of fuel pump	AD 2007-0060R1-E, SB912-053	2-2007
M	912 series Coolant	Coolant specification	AD 2007-0155	3-2007
O	912 TBO	TBO extended to 2000 hrs or 15 years	SB 912-057	5-2009
M	912 Magneto	Magneto flywheel hub washer	AD 2011-0067-E, SB912-058	2-2011
M	912 Crankshaft	Crankshaft crack inspection	AD 2011-0224-E, ASB 912-059	6-2011
M	912 Oil Pump	Check oil pump attachment bolts	AD 2012-0019-E, SB 912-060	1-2012
M	912 Fuel pump/pipe	Inspect fuel pump to check type/serial no, then pipe change	AD-2012-0093-E, ASB-912-061	2-2012
M	912 Fuel pump/pipe	Fuel pump pressure side hose replacement (Supersedes AD 2012-0093)	AD 2012-0097R1, ASB 912-061R1	3-2012
M	912 Cylinder head	Inspection/replacement	AD-2013-0055-E, ASB-912-062	2-2013
			AD 2013-0117-E, ASB 912-062R2	3-2013



BGA Airworthiness Compendium
Compendium of Airworthiness Directives, Mandatory Modifications, Special Inspections and Checklist of Defects
Engines

Rotax 914 Series

Status	Subject	Detail	Reference Information	TNS
M	914F. Mixture	Verification or calibration of the mixture enrichment jet	AD88, TB914-03	
M	914F. Oil System	Check of banjo bolt in turbo charger line	AD90, TB914-04	
M	914F. Oil System	Replacement of turbo oil pressure line and pipe clamps	AD95, TB914-07	10/98
M	914F, Propeller gearbox	Inspection and exchange of gearbox	AD 101, SB914-010R1	04/00
M	914F Starter	Engine starter inspection	AD 98, 914-014R3	06/00
M	914F. Stator	Inspection of engine Stator assay.	AD98, SB914-014R3	06/00
M	914F Valves	Replacement of valve spring retainers	AD108, SB914-011	06/01
		AD Cancelled by EASA	AD113R1, SB914-022R1	3-2009
M	914 F Engine mount	Inspection	AD105R1, SB914-016R1	02/03
M	914 F Exhaust	Inspection	AD106R1, SB914-017R1	02/03
M	914 F Crankcase	Inspection	AD107R3, SB914-018R1	04/03
M	914 F Oil system	New Oil Dipstick	AD 116, SB914-026 R1	10/03
M	914 F series Exhaust	Inspection	AD 117, SB 914-028R1	10/03
M	914 F Coolant	Introduction of new coolant	AD-A-2004-004R2, SB-914-029	2-2006
M	914 F Exhaust	Inspection of Muffler	EASA AD 2006-0127, SB-914-028 R1	3-2006
M	914 F Oil system	Inspection of magnetic plug within 5 hours and at oil change	AD 2006-0316-R1, SB 914-034	2-2008
M	914 series Inspections	Crankcase inspections	AD 2007-0025, SB914--18R3	1-2007
M	914 series Coolant	Coolant specification	AD 2007-0155	3-2007
O	914 TBO	Extended to 2000 hrs/15 yrs	SB 914-039	2-2010
M	914 Magneto	Magneto flywheel hub washer	AD 2011-0067-E, SB914-041	2-2011
M	914 Fuel	Fuel regulator insp & replacement	AD 2011-0082, SB 914-040	3-2011
M	914 Crankshaft	Crankshaft crack inspection	AD2011-0224-E, ADB 914-042	6-2011
M	914 Oil Pump	Check oil pump attachment bolts	AD 2012-0019-E, SB 914-043	1-2012
M	914 Cylinder head	Inspection/replacement	AD-2013-0055-E, ASB-914-044 AD 2013-0117-E, ASB 914-044R2	2-2013 3-2013

Rotax 500 Series

Status	Subject	Detail	Reference Information	TNS
M	501 & 505. Piston pin bearing	Conversion to reinforced design	AD64, SB505-05	
M	505 & 505A. Ignition	Conversion to the new electronic box	AD69, TB505-06	
M	Maintenance Schedule	New On Condition for all Rotax 2 stroke engines models 275, 501, 505, 535.	SB 505-010, SB 535-009	5-2006



BGA Airworthiness Compendium
Compendium of Airworthiness Directives, Mandatory Modifications, Special Inspections and Checklist of Defects
Engines

SOLO ENGINES

Status	Subject	Detail	Reference Information	TNS
M	2350 series	Modification to propeller mountings	AD 2002-130/2, TM 4603-11	04/02
I	2625-01 & 02	Change of electronic control box	Schempp Hirth TN 825032, 868-6	02/04
I	Various	Cracked starter ring gear		1-2007
M	2 625	Prop slip clutch inspection/modification	AD 2007-0001R1-E	1-2007
M	Maintenance	Solo engines are subject to the following annual checks: <ul style="list-style-type: none"> - Model 2 350 – 5 Year special inspection and 200 hour TBO - Model 2 350 suffix C or D - 200 hour TBO - Details on Schempp-Hirth web site are currently incorrect (5/3/10) 		1-2010
I	2 350 & 2 350D	Incorrectly drilled holes filled with resin	SB 4603-12	5-2011
	Mikuni carburettor	Choke butterfly screws missing & loose		2-2012
	Propeller hub crack	(On Duo Discus T) propeller hub cracked		2-2012
	Propeller shaft	(DG 1000T) Inspection of the propeller shaft	AD 2012-0197	4-2012
	Carburettor	Leaking due to warped cover plates		4-2012
M	2350C	Installed in DG1000T use prohibited due crankshaft failures	AD 2013-0217-E	5-2013
M	2350C	Operation reinstated after modification	AD 2013-0217 R1, SB 4603-14	2-2014

HIRTH F10 SERIES ENGINES

Status	Subject	Detail	Reference Information	TNS
M	F10. Operation & maintenance	Operation and maintenance instructions for F10 aircraft engines – revision	AD69-142	



BGA Airworthiness Compendium
Compendium of Airworthiness Directives, Mandatory Modifications, Special Inspections and Checklist of Defects
Engines

LIMBACH SERIES ENGINES

UK Service Agent – [Anglia Sailplanes](#)

Status	Subject	Detail	Reference Information	TNS
M	L1700, L2000, L2400. Carburettor.	Leaking carb. Floats due to manf errors	AD97-237, TB55	02/94
M	SL1700E, EA, EB, EC. Mixture.	Mixture control – Rubber diaphragm of the governor piston	AD76-238, TB12	10/87
M	L2000EA. Starter Unleaded Mogas	Starter shaft support case of electric Starter Use of	AD97-003, TB52 TB50 & 53	04/97 10/99
M	L2400 Controls	Throttle lever spring breaking	AD-D-2005-275	08/05

In Service Reports (Advisory)

Status	Subject	Detail	Reference Information	TNS
	Engine oil dipstick	Calibration to prevent over/under filling see Limbach TB 27	Limbach TB 27	02/05
	Hard landing damage	Suspect bent crankshaft and prop flange and crankcase cracks (oil leaks) after hard landing with VP prop and NO prop strike		06/05

MID WEST ENGINES

Status	Subject	Detail	Reference Information	TNS
M	Engine life extension	Generic Requirement No 24 for engine life extension not applicable for Mid West Engines		04/05

VW DERIVATIVE POWERPLANTS

Status	Subject	Detail	Reference Information	TNS
I	Stamo Engines Crankshaft	Use of Unleaded mogas Inspect for damage to the propeller shaft		12/99 04/00
I	Stamo Engines Rollason RS2	Propeller hub fixing bolt torque 20 MKG Cracked crankshaft at propeller flange drive keyway		04/00 1-2007



BGA Airworthiness Compendium
Compendium of Airworthiness Directives, Mandatory Modifications, Special Inspections and Checklist of Defects
Engines

GENERAL ENGINE INFORMATION

Status	Subject	Detail	Reference Information	TNS
	Aeroquip Hoses	Some are suspect.	See – Equipment section	10/88
	Slick Magnetos	Inspections and service lives	See – Equipment section	12/97
M	Stromberg Carburettors	Fit service kit at 500 hrs		10/87
	Unleaded Mogas	See CAA Airworthiness Notice 98c		12/99
M	Bendix Magnetos	Inspections and service lives	See – Equipment section	
M	Exhaust heat exchangers	Annual pressure test at 20 psi		08/92
	Motor Glider	Performance Data for C of A air test		10/98
	PVC Tubing	PVC tubing shrinks and becomes hard and brittle with prolonged exposure to fuel. Replace regularly.		04/99
	General	Reminder that engines, propellers, magnetos, hoses have service lives.		08/00
I	Flexible Hoses	Fatigue problems on incorrectly clamped hoses		08/05
I	Carburettors	FAA Special Airworthiness Information Bulletin for carburettor overhaul	NE-10-05	4-2009
A	Engine controls	Melting plastic liners. Ensure control is suitable in hot areas		2-2010
A	2 Stroke lubrication	Castrol product recall of 2 stroke oil		2-2013
I	Air filters	Ensure they are kept in good condition		3-2013

ELECTRIC POWER PLANTS

Status	Subject	Detail	Reference Information	TNS
M	Maintenance	Maintenance requirements for electric engines	BGA 053/06/2012	